# Improved Performance of JPCP Through a Better Awareness of Plastic Shrinkage and Drying Shrinkage

#### Transportation Forum

Julie M. Vandenbossche, P.E., Ph.D. and Nicole Dufalla University of Pittsburgh

February 5<sup>th</sup>, 2014



#### Shrinkage

- Plastic shrinkage cracking
  - Occurs in fresh concrete
  - Rate of evaporation exceeds surface water produced by bleeding
- Drying shrinkage
  - Effects slab shape
  - Influences fatigue stress





# Approach

- Review
  - construction practices
  - specifications
- Lab study



# Finishing




### Wet burlap drag micro texture



Excess surface water added



#### Wet burlap drag micro texture

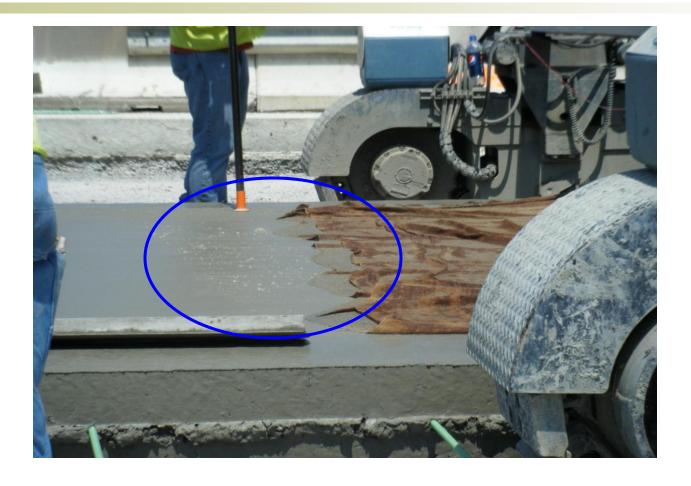

Excess surface water added



## Finishing

- Excess surface water worked into surface
- Micro texture removed by finishers





#### Excess surface water

Increases surface w/cm

Decreases durability of wearing surface Plastic shrinkage cracking





#### Plastic shrinkage cracking


- Effect on performance
  - Decreases surface durability
  - Potentially develop full depth if in central portion of the slab







# Full depth cracking

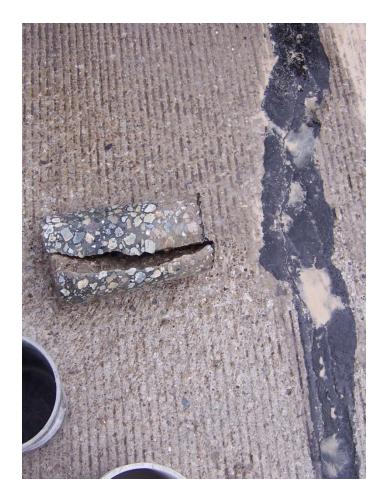

I-80 in Clinton County, PA





#### Plastic shrinkage cracking


#### I-80 in Clinton County, PA



(Crack has been digitally enhanced)



On core surface

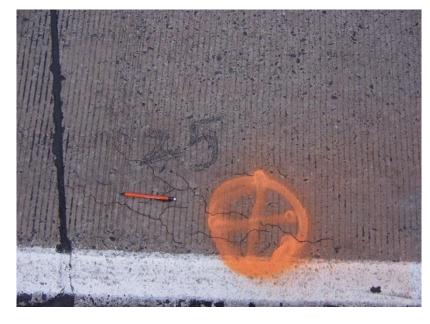

(Cracks have been digitally enhanced)

WO12: 4 out of 6 projects exhibited plastic shrinkage cracking



# Polishing/erosion





Vanport Limestone

**SR-22** 



#### Recommendations

- Eliminate soaked burlap
- Texture after finishing
- Other micro texture options





Astroturf drag

Broom



#### Resulting texture





7/30/2002

# Curing





Application with hand wand

#### **Nonuniform**






PennDOT specification requires curing cart





More uniform



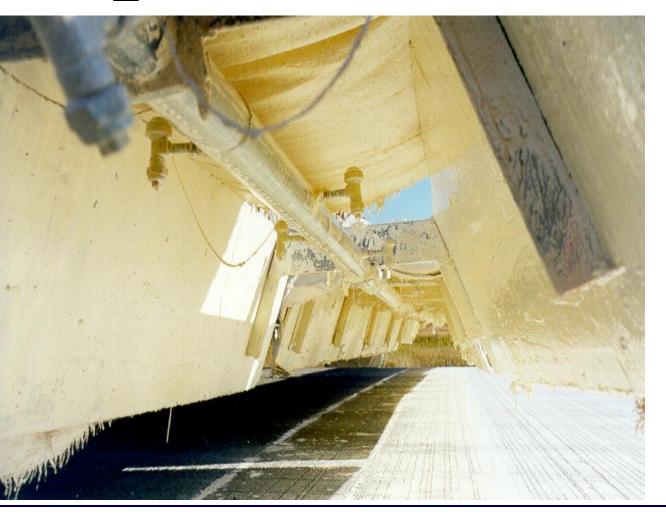




Nozzles must direct cure from 2 different lateral directions


or....

 2 sets of nozzles along 2 traverse lines, each line capable of complete coverage



# Coverage

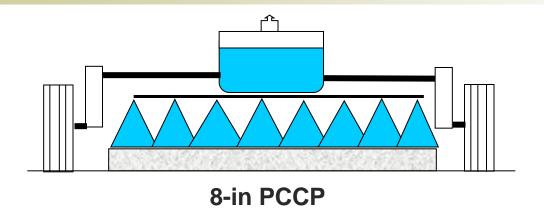

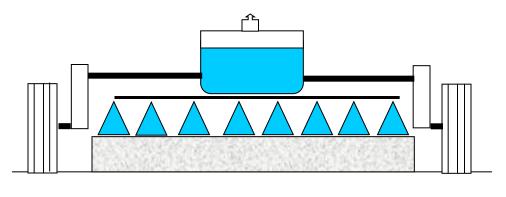

10-in PCCP



# Application rate

Measured: 220 sq ft/gallon





PA spec.: 150 sq ft/ gallon

Manufacturer's recommendations: 200 sq ft/ gallon



### Cart speed

```
Mph = 0.13636 GPM
GPF \times W
```

Mph = miles per hour

**GPM=** gal. per minute per nozzle

 $GPF = gal. per ft^2$ 

W = nozzle spacing (in)

Example: 8004 nozzle

@ 40 psi pump

pressure



0.45 mph (or 2400 ft/hr)



#### Curing compound storage

- Limit shelf life (1 yr from manufactured date)
  - Manufacturers recommendation
  - Don't allow to freeze



#### Effectiveness of curing compounds

- Variables considered
  - Wax vs resin
  - Resin type (Poly alpha methylstyrene (AMS), other)
  - % solids
- Parameters measured
  - Moisture loss
  - Strength
  - Permeability




# Moisture loss







#### Moisture loss, 3-day

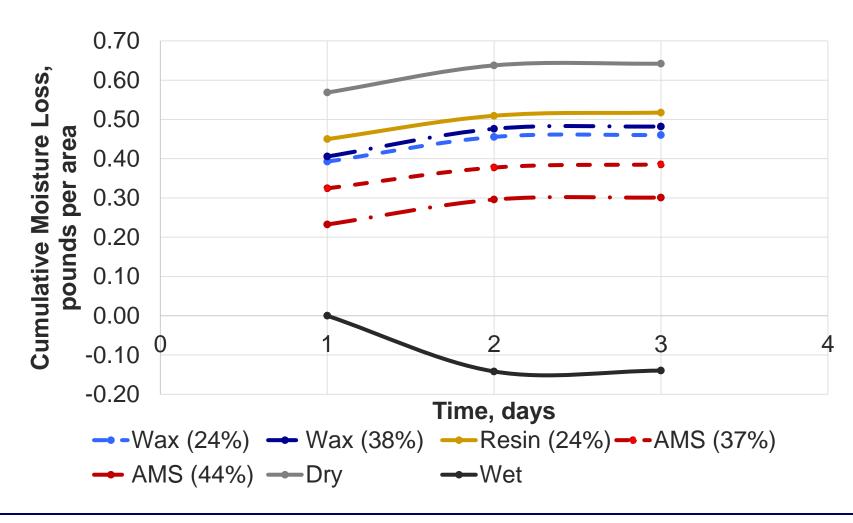



# Performance











#### Compression strength, 3-day

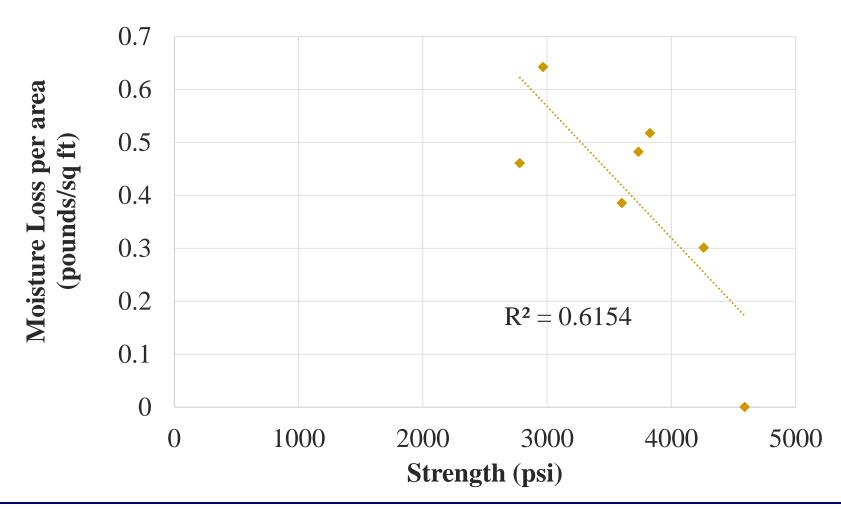



#### Compression strength, 7-day

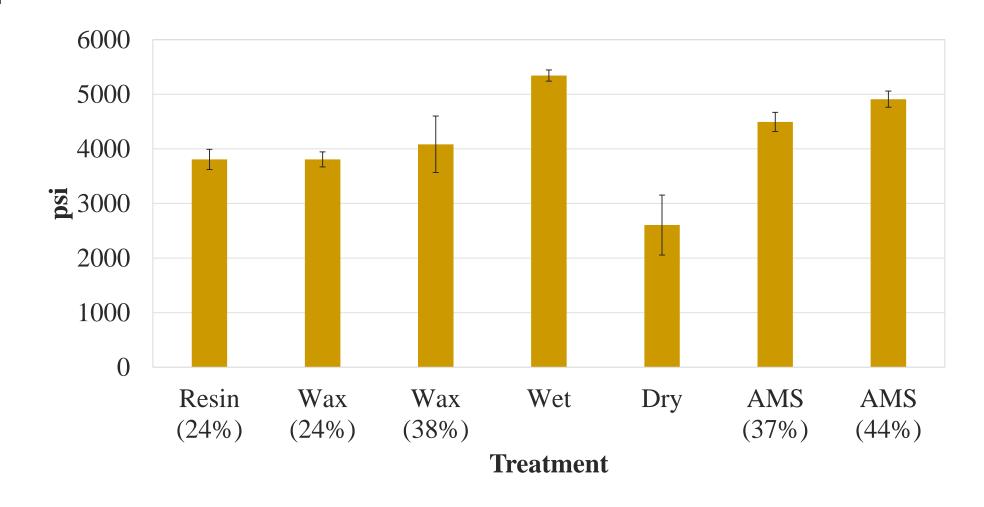



## Recommendations- Curing

44% Poly alpha methylstyrene

Poly alpha methylstyrene requirements		
Total solids (% by weight)	42 min	
% reflectance in 72 hours	65 min	
Loss of water in 24 hrs, lb/sf	0.03 max	
Loss of water in 72 hrs, lb/sf	0.08 max	
VOC content, lb/gal	2.93 max	
Infrared spectrum, vehicle	100% alpha methylstyrene	



#### Mix design

Criteria	Pennsylvania
Max. w/c ratio	0.47
Max cement content	752 lb/cyd

4 PennDOT Projects evaluated in 2011: w/cm =0.45, 0.47, 0.49 and 0.46

Min. cement content (600 lbs) and w/c ratio (0.40) to increase durability and decrease shrinkage



## Coarse aggregate gradation


Sieve	MN	PA
1 ½ in	100	100
1 1/4 in	95-100	
1 in		95-100
3/4 in	55-85	
½ in		35-60
3/8 in	20-45	
No. 4	0-7	0-10
No. 8		0-5

Specification allows for gap gradation

- Higher paste demand
- Segregation



#### Cement demand

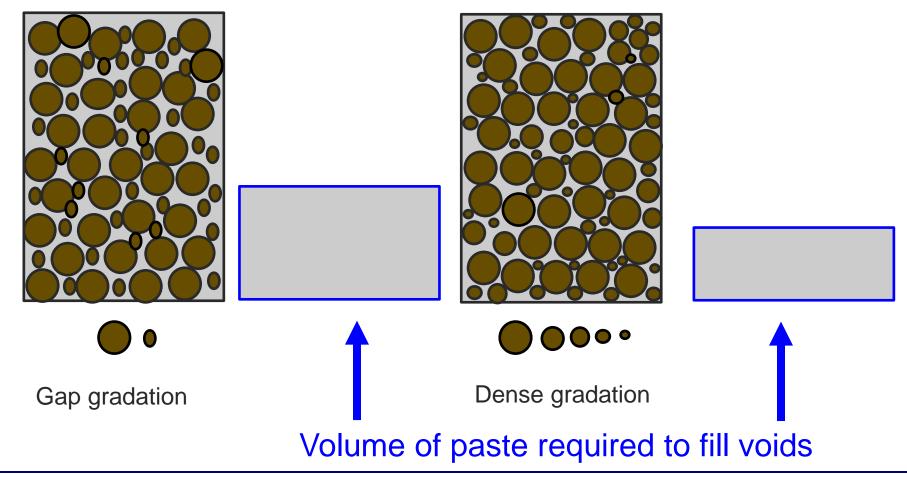



# Segregation



SR 202 Chester county, PA



SR 22 Murrysville, PA




I-79 Washington county, PA

Observed frequently for WO12



#### Coarseness factor chart

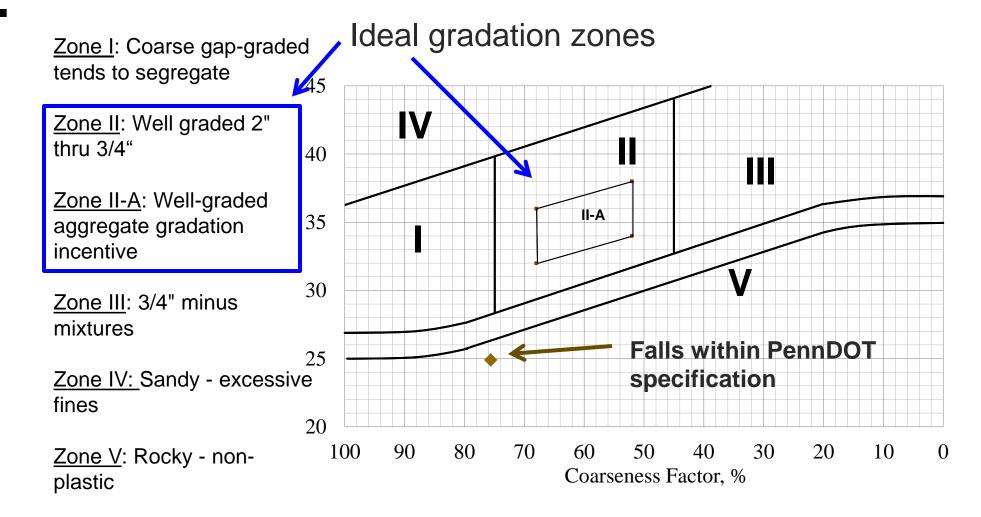




#### Recommendations- Mix design

- Minimize cement content
  - Adopt more densely graded aggregate
- w/cm ratio
  - New target of 0.40
  - Should fall between 0.38 and 0.42



## Critical areas

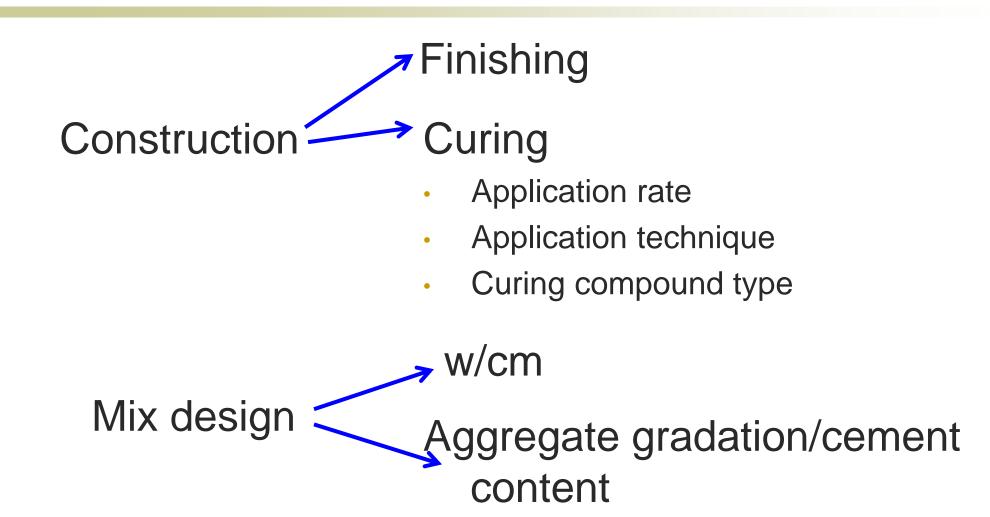



## Acknowledgements

#### Project coordination and technical assistance

Mr. Steven Marsinko, Mr. Leonard Kubitza and Mr.
 William Kovach

#### Site visits

 Mr. William Snyder, Ms. Roxanne Rossi, and Mr. David Schaeffer




### National Calibration of PCC Performance Models in AASHTO ME Pavement Design

NCHRP Project 20-07/Task 327


Julie M. Vandenbossche, P.E., Ph.D.
Steven Sachs
University of Pittsburgh



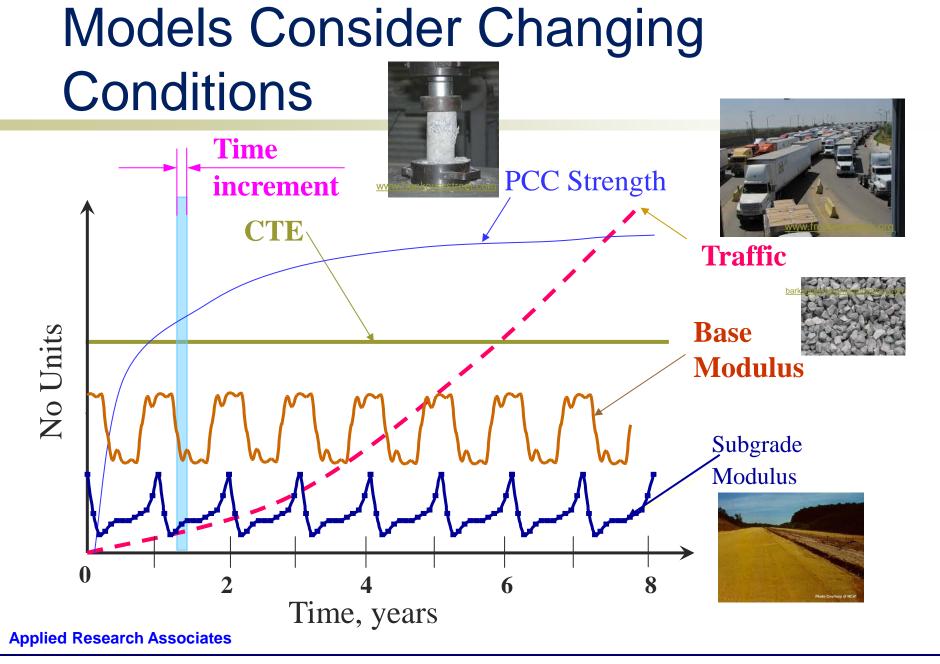



# New AASHTO Design PAVEMENT ME

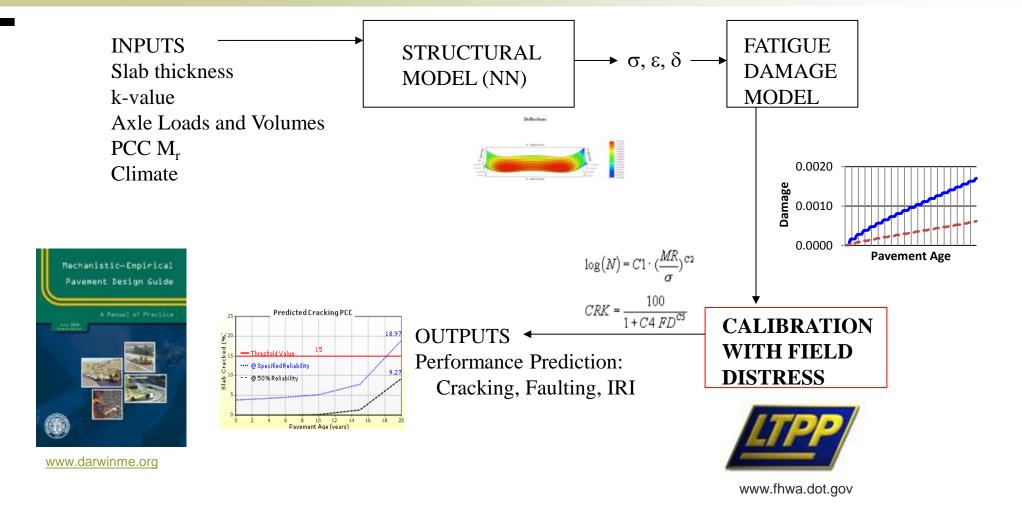



# JPCP joint faulting

$$FMAX_0 = \left[C_1 + C_2 * FR^{0.25}\right) * \delta_{curl} * \left[Log(1 + C_5) * 5^{EROD}\right) * Log(\frac{P_{200} * WetDays}{p_s})\right]^{C_6}$$

$$FMAX_{i} = FMAX_{i-1} + C_{7} * DE_{i} * [Log(1 + C_{5} * 5^{EROD})]^{C_{6}}$$

$$\Delta Fault_i = (C_3 + C_4 * FR^{0.25}) * (FMAX_{i-1} - Fault_{i-1})^2 * DE_i$$

$$Fault_i = Fault_{i-1} + \Delta Fault_i$$

$$\Delta DOWDAM_{tot} = \sum_{j=1}^{3} \sum_{i=1}^{N} C_8 * F_{ij} \frac{n_{ij}}{df_c^*}$$





M-E PDG (2004) (NCHRP 1-37A)

Original Performance Model Calibrations M-E PDG (2006) (NCHRP 1-40)

Recalibrated Performance Models

- Expanded datasets
- Updated software

Pavement ME (2013)

Functionally same version of the software

DARWin-ME (2011)

AASHTOWare software version

- Improved GUI
- Decreased run times





# Error in estimating Coefficient of Thermal Expansion (CTE)

- 304 SS CTE inaccurate over typical PCC service temp.s
  - $0^{\circ}\text{C} 500^{\circ}\text{C} \rightarrow 17.3^{*}10^{-6}/^{\circ}\text{C}$
  - $10^{\circ}\text{C} 50^{\circ}\text{C} \rightarrow 15.8 \text{-} 16.2 \text{*} 10^{\text{-}6} \text{/}^{\circ}\text{C}$

Steel CTE too high → PCC CTE to high

LTPP. database populated w/ incorrect CTEs Models need recalibration with correct CTEs





### Importance of CTE for pavements

Can contribute to:


- LTE, Spalling & Faulting → Joint opening
- % Cracking Cracking → Thermal curling








# Pavement ME Design Guide Sensitivity to CTE

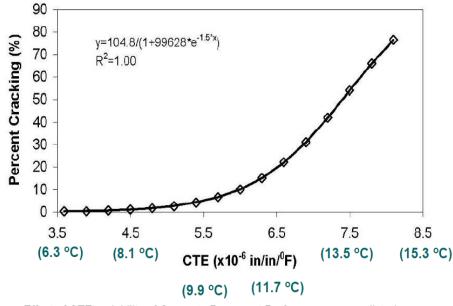

Effect of CTE variability of Concrete Pavement Performance as predicted using the Mechanistic - Empirical Pavement Design Guide, Jussara Tanesi, M. Emin Kutay, Ala Abbas, and Richard Meininger, Transportation Research Board 2007.

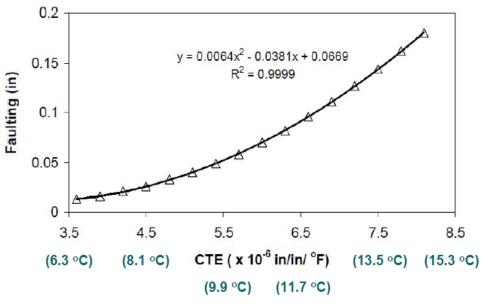

Effect of CTE variability of Concrete Pavement Performance as predicted using the Mechanistic - Empirical Pavement Design Guide, Jussara Tanesi, M. Emin Kutay, Ala Abbas, and Richard Meininger, Transportation Research Board 2007.



## Recalibration

#### NCHRP Project 20-07/Task 288 initiated


- Recalibrated:
  - JPCP (transverse cracking and faulting)
  - CRCP (crack width and punchout)
- Predicted slab thickness should be similar to original models
- Not implemented due to discrepancies in thickness designs

Previous National Calibration	1-37A	Task 288
*Average Predicted Slab Thickness (in)	11.37	10.57

\*Avg of sites w/in cracking factorial design (slab thickness required to meet default performance limits)




# New AASHTO Design PAVEMENT ME

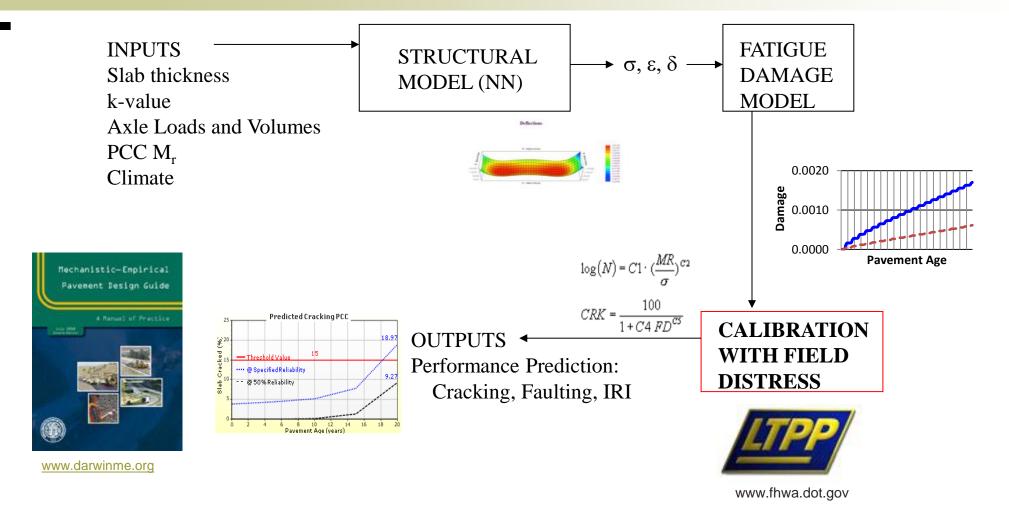




## PA LTPP included in national calibration

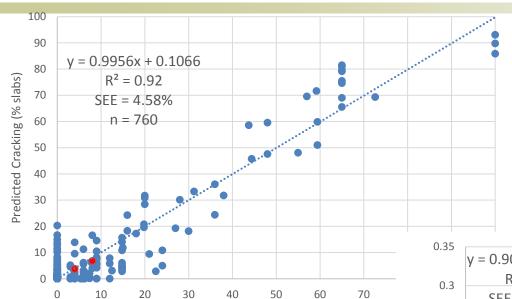

Measured Cracking (% slabs)

National calibration performed as part of NCHRP 20-07 Task 327.7

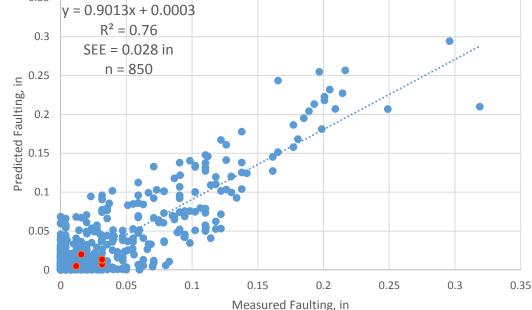


PA site highlighted in red




#### PA LTPP Sites

- Only 2 JPCP sites in national calibration database
- Principal Arterial Interstate
- Part of GPS-3 (JPCP)

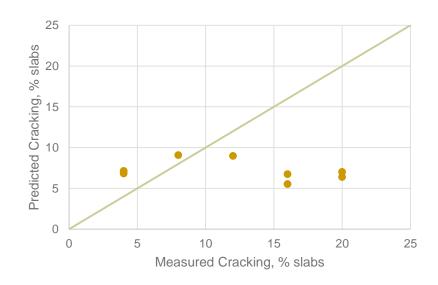




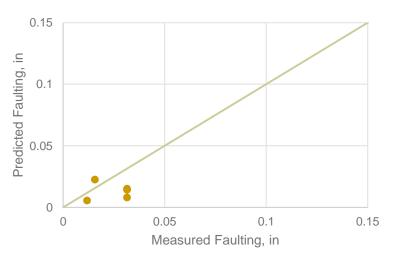




### PA Predicted vs. Measured

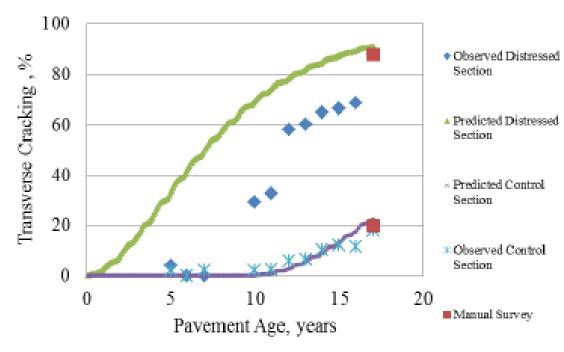


SR60: Segments 323 and 303

From PennDOT WO # 12 Report: Premature Deterioration of Jointed Plain Concrete Pavements

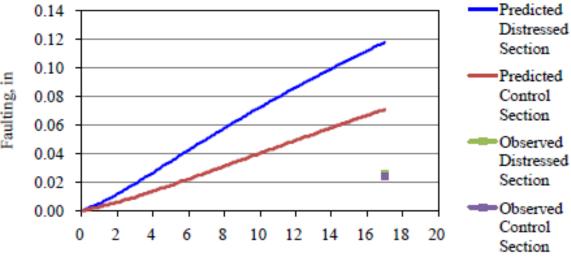




ring

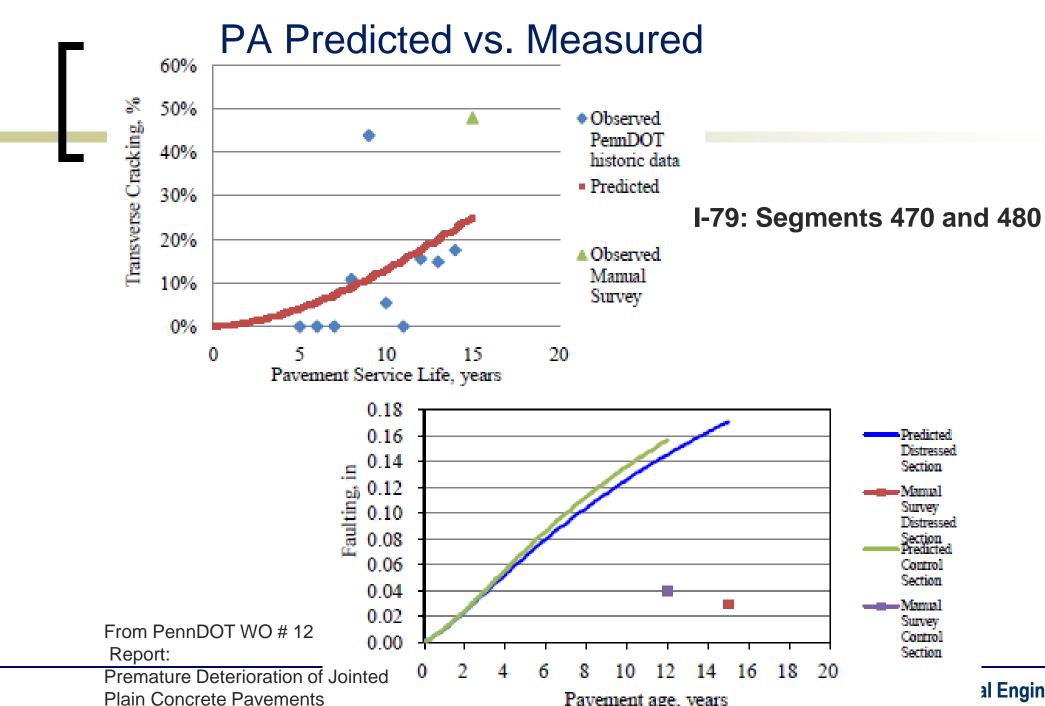



#### PA Predicted vs. Measured

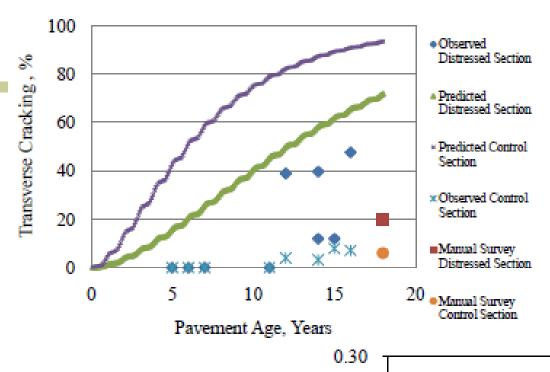


From PennDOT WO # 12

Plain Concrete Pavements

Report:

I-80 Segments 1914 and 1920

ring

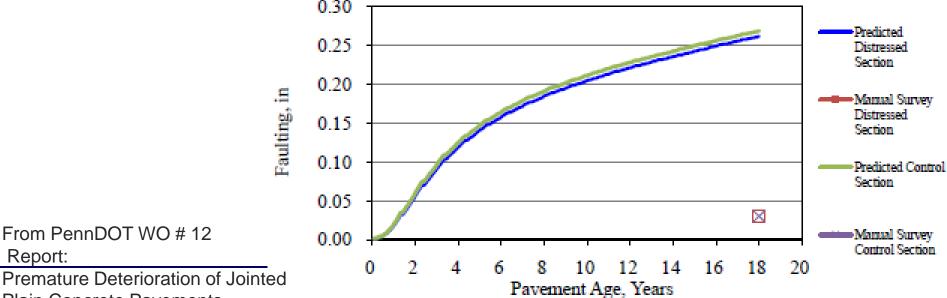

# PA Local Calibration

- Representative date for recalibration
- Friction values
- Built-in gradient



# Available PA calibration data

- 29 JPCP sections in PA
- Only 15 have distress data available
- Of those 15 sites, only 5 were not repaired with patching or another rehabilitation



### Thank You



## **Any Questions?**

Email: jmv7@pitt.edu

